National Transportation Safety Board NTSB ID: ANCOOLA017 Aircraft Registration Number: N5187B FACTUAL REPORT Occurrence Date: 12/06/1999 Most Critical Injury: None Occurrence Type: Accident Investigated By: NTSB ETYBO Location/Time Nearest City/Place State Zip Code Local Time Time Zone **BETHEL** 0958 99599 AST ΑK Distance From Landing Facility: Direction From Airport: Airport Proximity: On Airport Aircraft Information Summary Aircraft Manufacturer Model/Series Type of Aircraft Cessna 208B Airplane Sightseeing Flight: No Air Medical Transport Flight: No

Narrative

Brief narrative statement of facts, conditions and circumstances pertinent to the accident/incident:

On December 6, 1999, about 0958 Alaska standard time, a wheel equipped Cessna 208B airplane, N5187B, sustained substantial damage after colliding with snow-covered terrain during takeoff from the Bethel Airport, Bethel, Alaska. The flight was being conducted under Title 14, CFR Part 135, as a scheduled commuter flight, operated by Arctic Circle Air, Inc., as Flight 30. The certificated airline transport pilot, and the sole pilot-rated passenger aboard, were not injured. Visual meteorological conditions prevailed, and company VFR flight following procedures were in effect for the flight to Marshall, Alaska.

During a telephone conversation with the National Transportation Safety Board investigator-in-charge on December 6, the pilot reported that he arrived at the airport about 0800, and performed a preflight inspection of the accident airplane. He said that the airplane had been parked outside all night, and added that the wings, horizontal stabilizer, elevators, and windscreen had a "noticeable amount of frost on them." The pilot reported that he used a broom, while standing of a ladder, to remove an accumulation of frost, and light snow. He then returned to the hanger to wait for the load of cargo to arrive. He said that due to scheduling delays, the cargo did not arrive at the airport until about 0850, at which time the cargo was loaded, and the pilot prepared for departure. He said that before departure, he did not recheck the wings or flight control surfaces for any additional frost accumulation. The pilot reported that while departing runway 36, about 100 feet above the runway, he retracted 10 degrees of flaps. He added that as the airplane climbed to about 200 feet above the runway, he retracted the remaining 10 degrees of flaps, and the airplane descended while rolling to the left. The pilot stated that he had to apply full right aileron to keep the airplane upright. He said full power was already applied to the engine, but the airplane continued to descend. The airplane landed on the runway, about 200 feet from the runway threshold, and continued off the end of the runway, into snow-covered terrain.

The airplane sustained substantial damage to the propeller, fuselage, and wings.

National Transportation Safety Board

NTSB ID: ANCOOLA017

FACTUAL REPORT			rrence Date	: 12/06/1999								
AVIATION	rrence Type	rence Type: Accident										
Landing Facility/Approach Inf	ormation											
Airport Name Air				Airport Eleva	levation Run		way Used Runwa		ay Leng	th	Runv	way Width
BETHEL			BET	123 Ft	. MSL	SL 36 6398		6398	} 1		150	
Runway Surface Type: Asphalt		•								·		
Runway Surface Condition: Snow-	-dry											
Type Instrument Approach: NONE												
VFR Approach/Landing: Forced La	anding											
Aircraft Information												
Aircraft Manufacturer Cessna			Model 208E	I/Series 3						ial Number 8B0270		
Airworthiness Certificate(s): Normal												
Landing Gear Type: Tricycle												
Homebuilt Aircraft? No	Number of Seats:	2	Certifie	Certified Max Gross Wt.			8750 LBS Number			er of Engines: 1		
			Engine Ma	Engine Manufacturer: Model/Series: P&W PT6A-114A					Rated Power: 675 LBS			
- Aircraft Inspection Information												
Type of Last Inspection			Date of Las	Date of Last Inspection Time Si			ince Last Inspection				ne To	tal Time
AAIP 11				11/22/1999 42 Ho					ours 6105 Hours			
- Emergency Locator Transmitter (I	ELT) Information											
ELT Installed? Yes ELT Operated? No				ELT Aided in Locating Accident Site?								
Owner/Operator Information												
Registered Aircraft Owner Street Address P.O. BOX 60049												
ARCTIC AIR GROUP, INC.				City							е	Zip Code 99706
Operator of Aircraft	Street Address Same as Reg'd Aircraft Owner											
Same as Reg'd Aircraft Owner				City						State	Э	Zip Code
Operator Does Business As: ARCTIC CIRCLE AIR SERVICE, INC Operator Designator Code: ACSA												
- Type of U.S. Certificate(s) Held:												
Air Carrier Operating Certificate(s):	Commuter Air C	arrier										
Operating Certificate:				Operator (Certificate	e:						
Regulation Flight Conducted Under	: Part 135: Air Ta	axi & Co	ommuter									
Type of Flight Operation Conducted	Unknown											
		FACTI	UAL REPO	ORT - AVIAT	ION							Page 2

National Transportation Safety Board
FACTUAL REPORT
AVIATION

NTSB ID: ANCOOLA017

Occurrence Date: 12/06/1999

AVIAT	ION	Occurrence Type: Accident									
First Pilot Information											
Name				City			State	Date of Birth	Age		
On File			On File			On File	On File	43			
Sex: M Seat Occupie	d: Left	Prir	ncipal Profes	Pilot		Certi	ficate Nun	nber: On File			
Certificate(s): Airline Transport											
Airplane Rating(s): Multi-engine Land; Single-engine Land											
Rotorcraft/Glider/LTA: None											
Instrument Rating(s): Airplane											
Instructor Rating(s): None											
Type Rating/Endorsement for Accident/Incident Aircraft? Current Biennial Flight Review?											
Medical Cert.: Class 2	al Cert. Statu	s: Valid Med	ivers/lim.		Date of Las	t Medical	Exam: 04/26/19	999			
•											
- Flight Time Matrix All A/C This Make and Model			Airplane Single Engine	Airplane Mult-Engine	Night	Instru Actual	ment Simulated	Rotorcraf	Glider	Lighter Than Air	
Total Time	4375	750	3450	275	200	100	125				
Pilot In Command(PIC) 4225 740		740	3300	250	200	100	125				
Instructor								_			
Last 90 Days	288	118	262	26	12	19	1				
Last 30 Days Last 24 Hours	98	50 3	76 3	21	10	8		+			
Seatbelt Used? Yes	Used? Yes	Toxico	Toxicology Performed? No Second Pilot? Yes								
5											
Flight Plan/Itinerary											
Type of Flight Plan Filed: (Company VF	R									
Departure Point					State	Airp	ort Identifier	Dep	arture Time	Time Zone	
Same as Accident/Incid				BE ⁻	BET		8	AST			
Destination			State	Airp	Airport Identifier						
MARSHALL			AK		MLL						
Type of Clearance: None											
Type of Airspace: Class D											
Weather Information											
Source of Briefing: Company; Flight Service Station											
Method of Briefing:											
FACTUAL REPORT - AVIATION Page 3											

National Transportation Safety Board

FACTUAL REPORT

AVIATION

NTSB ID: ANCOOLA017

Occurrence Date: 12/06/1999

Occurrence Type: Accident

VETY BOR						Accidei	IL							
Weather	Information													
WOF ID	Observation Time	Time Zone	WOF	Elevatio	า	WOF Distance From Accident			dent Site		Direction From Accident Site			
PAB	0953	AST		123 Ft. N	//SL				0 NM		0 Deg. Mag.			
Sky/Lowes	t Cloud Condition: Scatt	ered					6500 Ft. AGL Condition of Li					ight: Dawn		
Lowest Ce	iling: Unknown			0 Ft. A	GL	Visib	Visibility: 10 SM A			Altii	timeter: 29.00 "Hg			
Temperature: -24 °C Dew Point: -18 °C					Wind	d Direction: 280 Density Altitude:							Ft.	
Wind Speed: 10 Gusts:					Weather Condtions at Accident Site: Visual Conditions									
Visibility (R	RVR): 0 Ft.	Visibility	(RVV)	0	SM	Intensit	y of Preci	pitation:	Unknown					
Restriction	s to Visibility: None													
Type of Precipitation: None														
Accident	Information													
Aircraft Damage: Aircraft				raft Fire:		Aircraft Exp				kplosion				
Classification:														
- Injury Su	mmary Matrix	Fatal	Serious Mino			None	TOTAL							
First Pi	lot					1		1						
Second	d Pilot													
Studen	t Pilot													
Flight I	nstructor													
Check	Pilot													
Flight E	ngineer													
Cabin A	Attendants													
Other C	Crew													
Passen	igers					1		1						
- TOTAL A	ABOARD -					2		2						
Other G	Ground	0	0		0			0						
- GRAND) TOTAL -	0	0		0									
		•		•	•		•	•						

National Transportation Safety Board

FACTUAL REPORT AVIATION NTSB ID: ANCOOLA017

Occurrence Date: 12/06/1999

Occurrence Type: Accident

Administrative	

Investigator-In-Charge (IIC)

CLINTON O. JOHNSON

Additional Persons Participating in This Accident/Incident Investigation:

GLENN R SMITH (FAA) 4510 WEST INT'L AIRPORT ROAD ANCHORAGE, AK 99502